




Conduct inspection services

Profiler Report

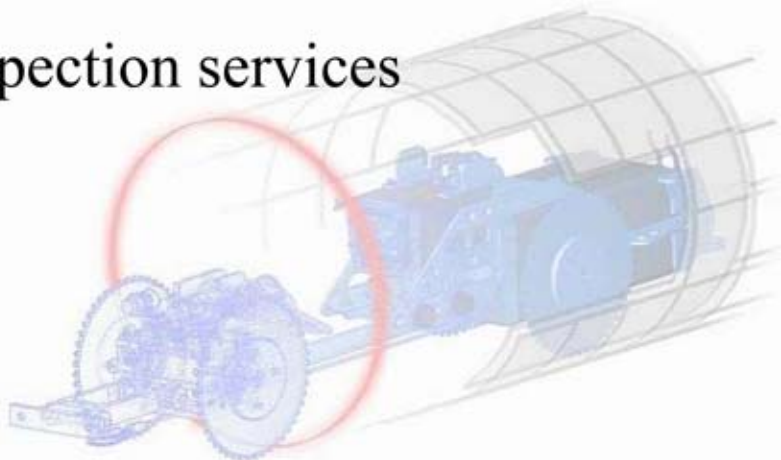

General informations

Client	Company Name
Project number	700052
Town	Los Angeles
Date	01/12/2007

Your Authorized Dealer is:

Municipal Equipment Sales, Inc.

Mailing Address: PO Box 1233
Location: 208 Bell Place
Woodstock, GA 30188



Local: 770-928-0424
Fax: 770-928-7612
Nationwide Toll Free: **1-800-782-2243**
Email: sales@municipalequipment.com
Web: www.municipalequipment.com






Inspected section details				
Date	Road	Upstream	Direction	Downstream
Jan 12 2007	First avenue	RP-39	<<<	RP-40



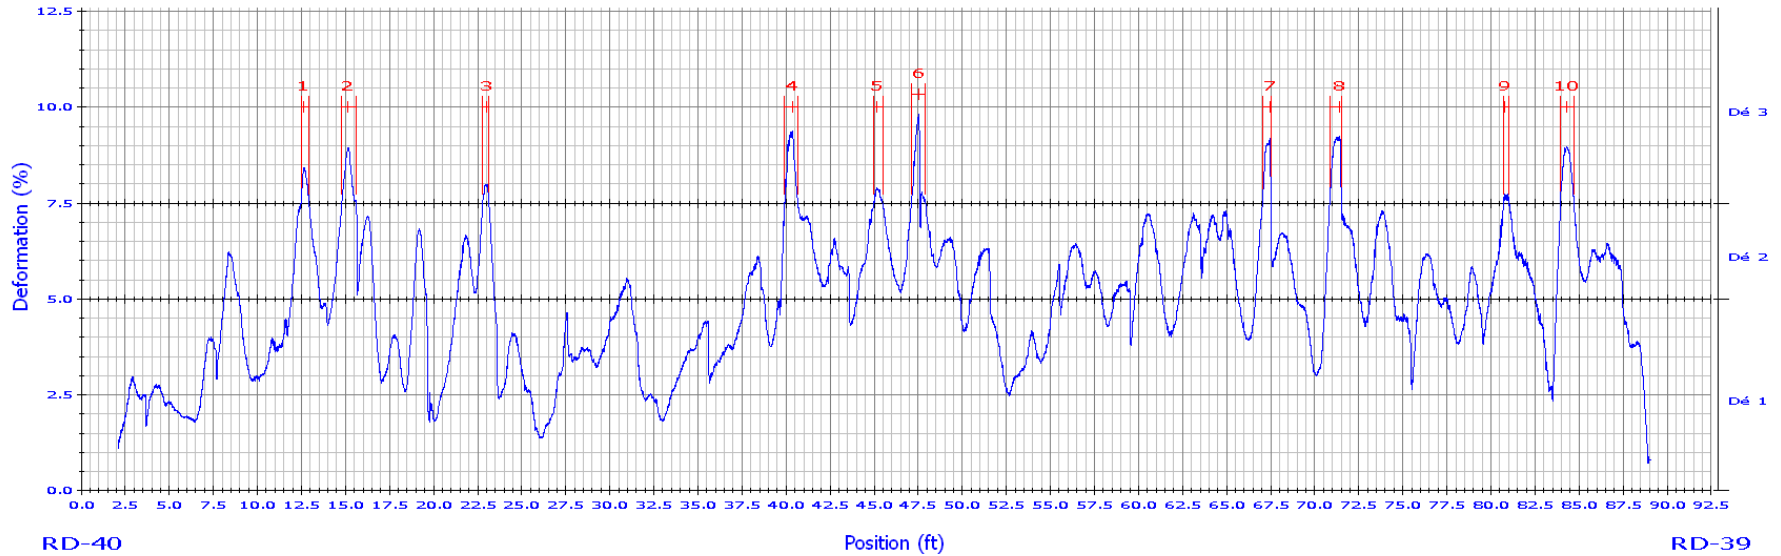


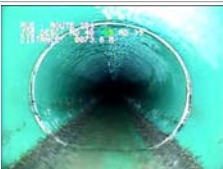




Inspected section characteristic				
Network type	Material	Nominal diameter (in)	Measured diam. at the beginning (in)	Length (ft)
Sewer	Polypropylene	12.0	12.13	82.00

Ovalisation % (Limit 7.5%)





Observation(s)							
No.	Deformation position			Maximum deformation		Laser image	Video image
	Start (ft)	End (ft)	Length (ft)	Position	Max. Value		
1	12.51	13.08	0.57	12.72	8.43 %		
	Comment :						
2	14.72	15.63	0.91	15.08	8.95 %		
	Comment :						
3	22.75	23.07	0.32	23.02	7.98 %		
	Comment :						
4	39.89	40.72	0.83	40.38	9.37 %		
	Comment :						
5	44.98	45.50	0.52	42.12	7.82 %		
	Comment :						

Observation(s)							
No.	Deformation position			Maximum deformation		Laser image	Video image
	Start (ft)	End (ft)	Length (ft)	Position	Max. value		
6	47.12	47.88	0.76	47.52	9.72 %		
	Comment : Joint possibly cause an over-estimation of the ovalisation						
7	67.03	67.50	0.47	67.48	9.08 %		
	Comment : Joint possibly cause an over-estimation of the ovalisation						
8	70.81	71.5	0.69	71.33	9.22 %		
	Comment : Joint possibly cause an over-estimation of the ovalisation						
9	80.69	80.78	0.09	80.73	7.82 %		
	Comment :						
10	83.96	84.71	0.75	84.45	9.01 %		
	Comment :						